


DF

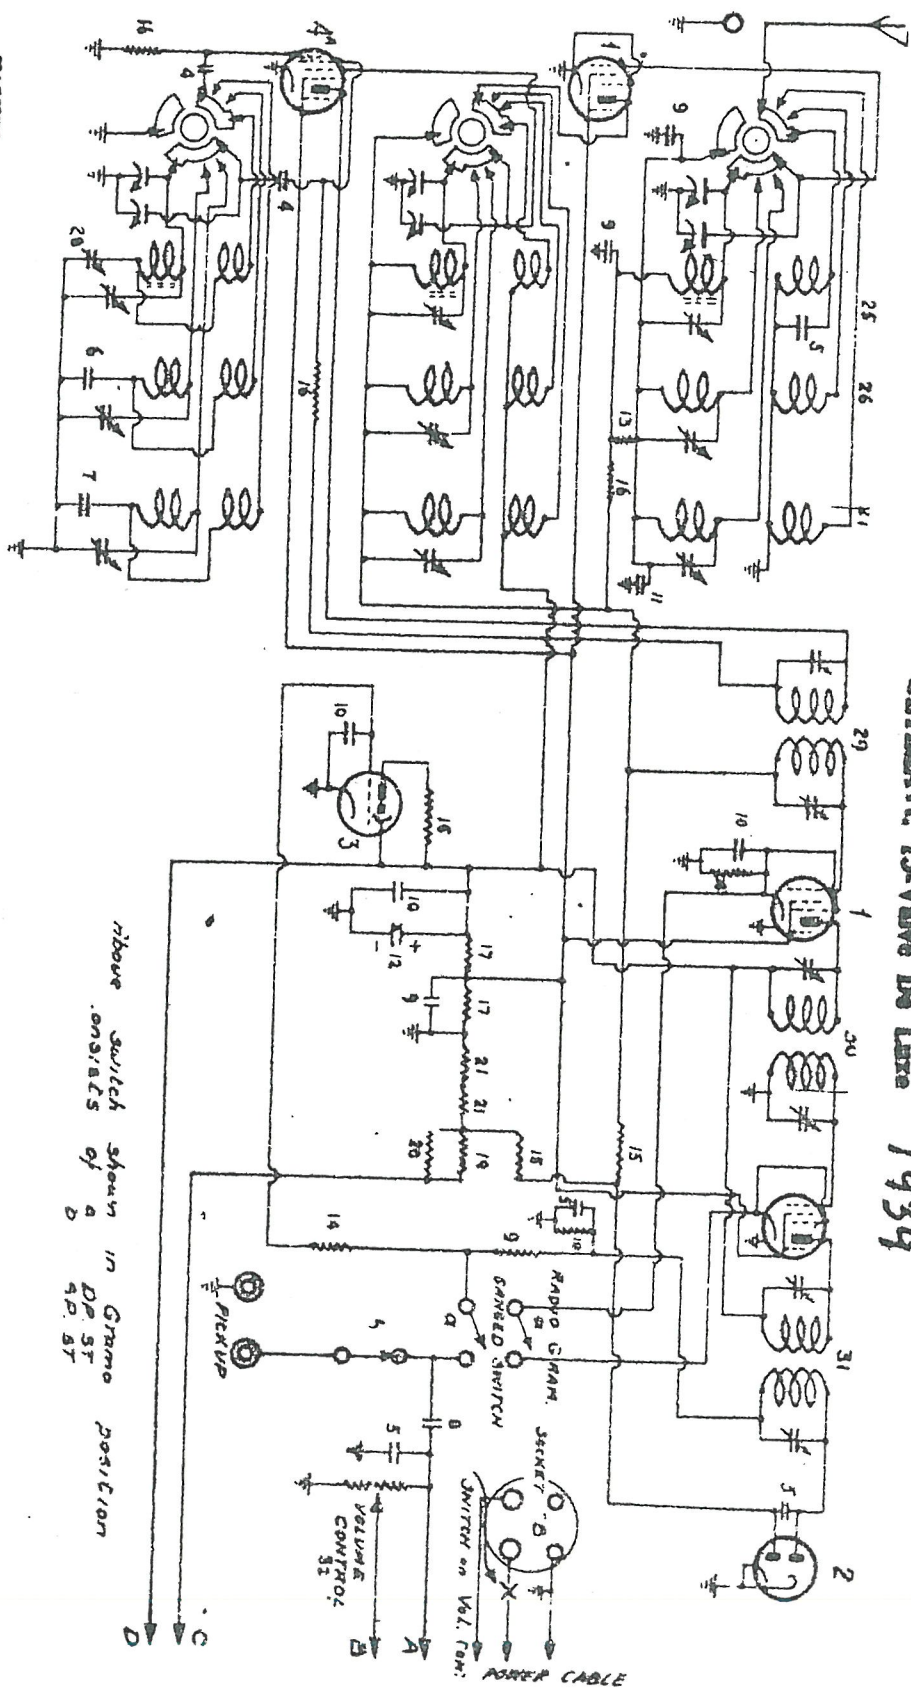

- VALVES.
1. GK7
2. GK8
3. GK8
4A. GK8
CONDENSERS.
4. .00005
5. .0001

- | | |
|-----|-------|
| 6. | .0015 |
| 7. | .004 |
| 8. | .02 |
| 9. | .05 |
| 10. | .25 |
| 11. | .5 |
| 12. | End |

- RESISTORS
13. 2 meg
14. 2 M ohms
15. 1 M ohms
16. 50,000
17. 10,000
18. 2000
19. 325

0. 100
1. 25
E. 25
GENERAL
3. ANT.
24. Dnd.
25. B.C.
26. YHD.

27. 3rd.
28. PC Padder TBS
29. 1st IP 480 KC
30. End IP 480 KC
31. 3rd IP 480 KC
32. Vol. Control
Pbm ohm

10

DF

1. 2. 3. 4. 5.
608 517 518 519 520

- VALVES.
1. 608
2. 617
3. 618
4. 616
5. 80

8. E28
CONDENSERS:
7. .0002Einf
8. .0001f
9. .0001f
10. .1mf

8. E28
CONDENSERS:
7. .0002Einf
8. .0001f
9. .0001f
10. .1mf

21.	.5mfd
14.	8mfd
13.	12mfd
14.	16mfd
15.	25mfd


- | | |
|-----|-------|
| 21. | .5mfd |
| 14. | 8mfd |
| 13. | 12mfd |
| 14. | 16mfd |
| 15. | 25mfd |

RESISTORS
16. 200 ohms
17. 2000 ohms
18. 5000 ohms
19. 5000 ohms
20. 10,000 ohms

- RESISTORS
16. 200 ohms
17. 2000 ohms
18. 5000 ohms
19. 5000 ohms
20. 10,000 ohms

21.	25,000	chms
22.	30,000	chms
23.	50,000	chms
24.	100,000	chms
25.	500,000	chms
26.	1,000,000	chms

- | | | |
|-----|-----------|------|
| 21. | 25,000 | chms |
| 22. | 30,000 | chms |
| 23. | 50,000 | chms |
| 24. | 100,000 | chms |
| 25. | 500,000 | chms |
| 26. | 1,000,000 | chms |



Note: all sockets & plugs viewed from the back

